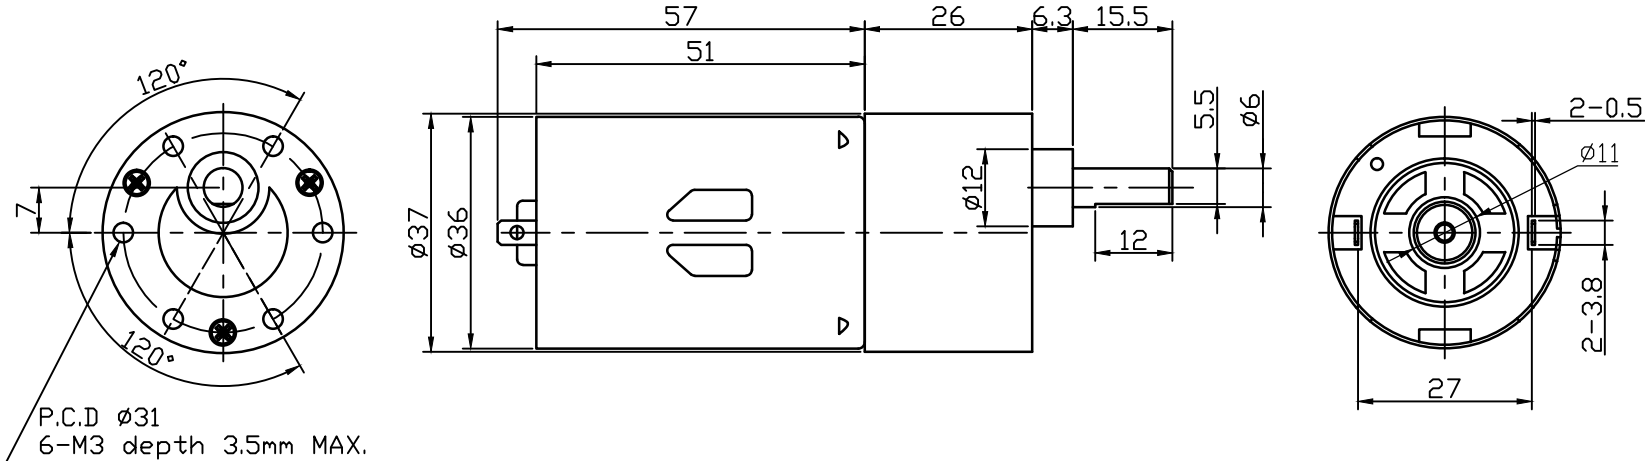


图号 (Drawing NO.)		SG01 (60KBC) -3004-000		型号 (Model No.)		SPG50-60K		电压 (Voltage)	
图纸 Drawing:		版次: 1.1		12V DC					
									
		客户确认 (Customer APP.):							
参数 Details:		减速电机参数 (Geared motor specification):				注意事项 (Notes):			
		空载电流 (No Load Current) (mA):		≤ 320		<div>1, 焊接作业请在短时间内实行。(推荐: 焊接头的温度340~400度, 2秒内实行) Please conduct the welding work in a short time.(Recommendation:With the soldering iron tip at a temperature of 340~400℃, within 2 seconds</div> <div>2, 在安装过程中不应使减速电机受到冲击、跌落。不允许直接在减速器出轴上敲打或压配。Prevent gear motor from being shocked or dropping in mounting process.It is prohibited to strike and crush directly on reducer output shaft.</div> <div>3, 安装螺丝请前先确认外观图所标示之形式及长度尺寸。Install the screws after first checking the taps and tap depth against the dimensions entered on the exterior drawing.</div> <div>4, 请小心使用, 勿使黏接剂借由输出轴流入轴内。 It is necessary to be careful that the adhesive does not spread along the shaft and flow into the bearing.</div> <div>5, 请不要在安装零件时为了调整位置而从输出轴方向去回转头轮马达。 Do not turn a geared motor by its output shaft when,for example,arranging its position so as to install it.</div>			
		空载转速 (No Load Speed) (r. p. m):		75 ± 7.5					
		额定力矩 (Rated Load Torque) (kgf. cm):		5.5					
		额定电流 (Rated Current) (mA):		≤ 1200					
		额定转速 (Rated Load Speed) (r. p. m):		56 ± 5.6					
		堵转电流 (Stall Current) (mA):							
		堵转力矩 (Stall Torque) (kgf. cm):							
旋转方向 (Rotation Direction):		CW/CCW							
备注 (Remarks):									
Draw:				Rev:				App.:	